PNL-MS

Belt Conveyor with Metal Detector

Date: Oct. 2021 Version: Ver.C (English)





Contents

1.	Ger	General Description6					
			g Principle res:				
			/ Regulations				
	_	-	Safety Signs and Labels				
2.	Stru	Structural Features and Working Principle12					
	2.1 Function Description						
		2.1.1	Working Principle	12			
3.	Inst	nstallation and Testing					
	3.1	Attent	ion	14			
	3.2	Horizo	ontal Installation	14			
	3.3	Powe	r Connections	15			
4.	Оре	Operation1					
	4.1	Opera	ation guide	16			
	4.2	Heigh	t adjustment	17			
	4.3	Adjus	ting the Central Position of the PU Belt	17			
5.	Tro	puble-shooting1					
6.	Ser	Service and Maintenance					
	6.1	Repai	r	20			
	6.2	Maint	enance	20			
		6.2.1	Maintenance of the Gearbox	20			
		6.2.2	Clearance of the Machine	21			
		6.2.3	Lubricate the Bearing	22			
	6.3	Maint	enance Schedule	23			
		6.3.1	About the Machine	23			
		6.3.2	Check After Installation	23			
		6.3.3	Daily Checking	23			
		6.3.4	Weekly Checking	23			



Picture Index


Picture 2-1: Working Principle	12
Picture 3-1: Horizontal Installation	14
Picture 3-2: Machine Installation Drawing	
Picture 4-1: Main Switch	
Picture 4-2: Twist Switch	
Picture 4-3: Frequency Converter	
Picture 4-4: Height Adjustment	17
Picture 4-5: PVC Adjusting Drawing	
Picture 6-1: Gear Motor	21
Picture 6-2: Bearing Pedestal	





1. General Description

 Please read this manual carefully before using this machine in order to operate correctly against any damage caused by improper operation.




PNL-MS belt conveyor with metal detector is a device which can detect the metal contained in the material during conveying and simultaneously activate the alarm. It is suitable for not only working together with Shini's granulator, such as SG-36, SG-43, SG-50 and SGS series, but also working with other series of belt conveyors. PNL-MS series feature reliable performance, easy operation and convenient height adjustment upon customer's requirements.



Model: PNL-MS-L4500



1.1 Coding Principle

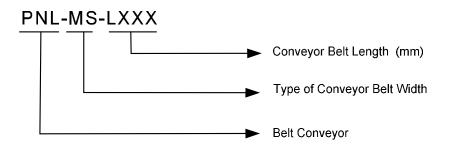

1.2 Features:

- Equip with channel metal detector to detect effectively the metal in the channel.
- PVC belt is adopted for smooth and efficient conveying.
- Height of the floor stand is adjustable.
- Sidewalls for PNL-MS series are 100 mm.
- Conveying speed could be adjusted within 1.3~8 m/min by transducer which is standard configuration.
- Power supply for PNL-MS series is 3Φ, 400V, 50/60Hz.



All service work should be carried out by a person with technical training or corresponding professional experience. The manual contains instructions for both handling and servicing. Chapter 6, which contains service instructions, is intended for service engineers. Other chapters contain instructions are for the daily operator.

Any modifications of the machine must be approved by SHINI in order to avoid personal injury and damage to machine. Warranty is inapplicable for any damage caused by unauthorized change of the machine.

Our company provides excellent after-sales service. Should you have any problem during using the machine, please contact the company or the local vendor.

Shini Hotline Service: Headquarter and Taipei factory: Tel: + 886 (0)2 2680 9119 Shini Plastics Technologies (Dongguan), Inc.: Tel: +86 (0)769 8331 3588 Shini Plastics Technologies (Pinghu), Inc.: Tel: +86 (0)573 8522 5288 Shinden Precision Machinery (Chongqing), Inc.: +86 (0)23 6431 0898



1.3 Safety Regulations

To avoid any body injures and damages of the machine, please obey the regulations in this manual. When operating this machine, please comply with the regulations as follows.

1.3.1 Safety Signs and Labels



Electrical installation should be done by qualified electricians. Turn off the main switch and control switch before servicing and maintenance.



Warning!

The sound level produced by the machine is \leq 80dB at the position of the operator.



Notice:

Noise level test refers to the following conditions: 1m around the machine, 1.6m above the machine.



Warning!

- 1) Don't use the machine and don't try to repair it before carefully reading this manual and understanding all its parts completely.
- In particular, it is important to adopt the precaution listed in the section 'safety instruction'.
- 3) It is forbidden to use the machine in any condition or for any use different from what is indicated in the manual. SHINI has no responsibility for breakdown, trouble, or injuries caused by improper operation.



Attention!

No need for regular inspection because all the electrical parts in the control unit are fixed tightly!



Attention!

The maximum weight of the pieces (average distribution) to be carried on the conveyor belt must not be over 150kg in total.

The conveyor belts are not suitable to transport loose material.



Attention!

These conveyor belts can be easily used by all of the personnel of the plant they are installed in, and they do not present any risk for the operator, if used properly.

Therefore, it is recommended to read the manual carefully before using the machine.



Attention!

SHINI claims no responsibility when:

- 1) Use of the conveyor belt is in any way openly opposed to what is indicated in the present instruction manual.
- 2) There are feeding defects.
- 3) There is a serious deficiency of the foreseen maintenance.
- 4) Non-authorized changes are adopted.
- 5) Spare parts that are non-authorized or not suitable for the actual model are used.
- 6) There are exceptional events.



Danger!

Risk of fire!

Risk of fire is present whenever the conditions of the conveyor belts are not suitable for the operation they are used for (in particular: temperature of the pieces carried). Adjust the condition of the conveyor belt according to the table shown here below.



Risks of high temperature:



These conveyor belts are designed for transporting molded parts, i.e. hot pieces. If you need to operate on the conveyor belt, use safety gloves. (In particular where the parts fall on the belt)

Type of belt	Max. temp. of parts	
PVC	60°C	



Attention!

The packing material must not be left around, and it must be disposed according to the regulations in force. It is possible to lift the conveyors with a fork lift.



Danger!

To protect the operator's safety, and the integrity of the machine, assure the stable lifting of the conveyor. Once the conveyor belt is running, it is necessary to fix the machine by locking the castors. Moreover, suitable slings or fixtures must be attached to keep it steady during transportation.




2. Structural Features and Working Principle

2.1 Function Description

PNL-MS horizontal belt conveyor with metal detector is a device which can detect the metal contained in the material during conveying and simultaneously activate the alarm. It is suitable for not only working together with Shini's granulator, such as SG-36, SG-43, SG-43, SG-50 and SGS series, but also working with other series of belt conveyors. PNL-MS series feature reliable performance, easy operation and convenient height adjustment upon customer's requirements.

2.1.1 Working Principle

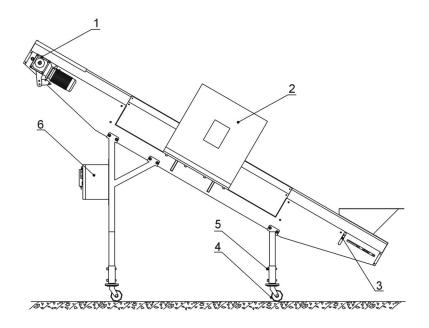

Parts Name:

1. Gear motor

2. Metal detector 3. Adjusting nut 4. Castor

5. Adjusting bolt 6. Control box

Picture 2-1: Working Principle

Working principle description:



Material is conveyed by the conveyor belt which is driven be the gear motor (1). The metal detector (2) stops the gear motor (1) and gives alarm by sending out a signal when material contains metals passing by the detector (2). The gear motor restarts after removing the metals and pressing the reset switch on the control box (6). The adjusting nut is available for centralizing and tightening the conveyor belt. Customers also can adjust the height of the conveyor by adjusting bolt (3). Castors (4) make the conveyor easy to move.




3. Installation and Testing

Read this chapter carefully before installation, Must observe the installation steps as follows!

 Δ The connection of the power supply should be done by qualified electricians only!

3.1 Attention

- 1) Verify that the power supply corresponds to the specifications of the plate near the controls of the conveyor.
- 2) Connect the power cable and the PE wire according to the local regulations.
- 3) Use independent power cable and switch, Make sure that the diameter of the cable is not smaller than the cable used in the control box.
- 4) The connection end of the power cable should be safely and tightly.
- 5) This series use the power with 3phase and 4wire, (L) connect to the live wire of the power, and the PE should be connected.
- Power supply requirement: Main power voltage: ±5% Main power frequency: ±2%
- 3.2 Horizontal Installation

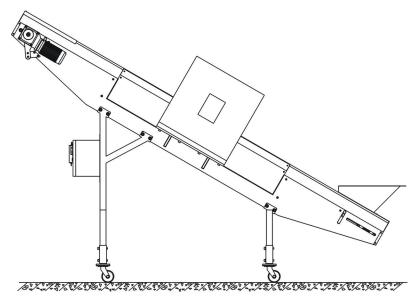

Picture 3-1: Horizontal Installation



Conveyors don't require any particular preliminary operation before starting-up. With reference to the layout of the cables, make sure that they are protected against damage and that they don't hamper the operators.

3.3 Power Connections

The wire of the horizontal belt conveyor, transducer and metal detector should be connected strictly comply with the wiring diagram.



Attention!

After the power connected, check the direction of the motor rotation, if the motor reverses, please turn off the power, change over the connecting wires of the L terminal.



Picture 3-2: Machine Installation Drawing



Attention !

Keep the machine away from the flammable object over 1m.



4. Operation

- 4.1 Operation guide
 - 1) Switch on the main switch;



Picture 4-1: Main Switch

2) Tweak the start switch at the "start" position to start the conveyor;



Picture 4-2: Twist Switch

3) Press the up/down button on the remote control panel to change frequency in order to change conveying speed of belt;



Picture 4-3: Frequency Converter

4) Please take out them as the metal detector detects metal objects, and then



press down the reset switch to start the conveyor again;


5) Control parameters of metal detector, which have been adjusted at best mode before delivery, are better not to change it by customer in principle.

4.2 Height adjustment

Loosen the lock nut (1) and take out the inner hexagon bolt (2) (M12x75), and then adjust the height of conveyor at a suitable level. After finished adjustment, retighten the lock nut (1).



Please use auxiliary device to lift or support the conveyor when adjusting its height in case it falls abruptly to result in machine damage of personal injury.

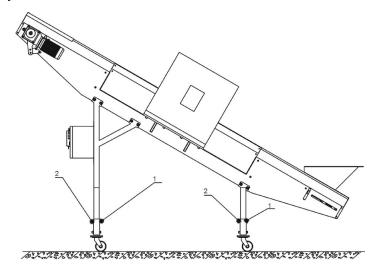

Picture 4-4: Height Adjustment




The conveyor will loss the balance state if forget to tighten the lock nut after height adjustment!

4.3 Adjusting the Central Position of the PU Belt

Rotate this nut to adjust the central space of the PU Belt



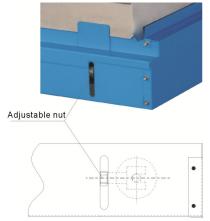

Picture 4-5: PVC Adjusting Drawing



Danger!

It must be to check if the PVC belt is at the suitable position while the conveyor is running. However, the adjustment must be done when the machine is stopped, and then the belt must be made to run only for the time necessary to verify its proper centering.

Attention!

On a monthly basis verify that the external temperature of the motor and gearbox is not too high (it should be between 60 and 20°C). In case it is different, contact the technicians at SHINI directly.



Attention!

- 1) The maximum weight of the pieces to be carried on the conveyor belt must not be over 56kg in total(Conveying capacity is less than 56kg as the set value of the regulator is smaller than 4.5m/min)..
- 2) Not suitable to transport loose material.
- 3) The maximum resistant temperature of PVC belt is 60°C.



The operator, or the maintenance technician, must wear suitable work clothes, without free parts. They must not wear chains, bracelets, or other objects which may be caught by mechanical parts in movement. In case of long hair, special hairnets must be used, to avoid the risk of being caught.




5. Trouble-shooting

Failures	Solutions
	1. Check if the transducer show 0Hz, if yes, it is need to adjust the
	setting value by up button on control panel.
Connect the power, rotate the	2. Check the circuit according to wiring diagram, the possible reasons
main switch and turn on the	can be as follows:
RUN / STOP switch, the motor	a: The power is failure.
doesn't run.	b: The circuit is disconnected.
	c: The motor protector is damaged.
	d: The motor is failure.
	Check the circuit according to wiring diagram, the possible reasons can
The size of the street of the string	be as follows:
The circuit breaker often trips	a: Short circuit may exist.
off.	b: The motor protector is damaged.
	c: The motor is failure.



6. Service and Maintenance

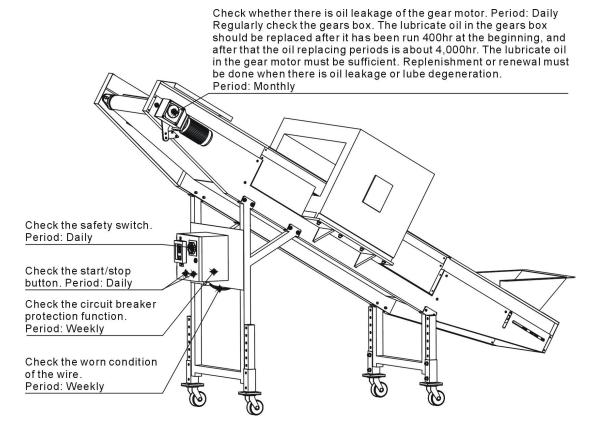

6.1 Repair

To avoid any body injury and damage of the machine, all of the repair work should be done by professional person only.

It is the duty of the operator to keep the machine clean from foreign matter, such as deposits, oil, or other materials. So it is necessary to clean the machine at the end of every working shift. This must be performed when the machine is stopped, in stable starting of the machine.

6.2 Maintenance

6.2.1 Maintenance of the Gearbox

Check if the reduced gears box is oil leaking and it should be examined periodicity. When you find that the oil is reduced or the color of it changed dark and black, you must complement it or replace it immediately. Please be noticed that keep the surface of the gear motor cleaning. Move away the dust and the contamination in time so as to keep a good distribute of the heat.





Picture 6-1: Gear Motor



The suitable temperature range of the motor and the gearbox is between 20° C- 60° C.

6.2.2 Clearance of the Machine

Please keep the machine clean from foreign matter, such as deposits, oil, or other materials. Do the cleanly work everyday.

It is forbidden to use flammable liquids during the cleaning operation. Periodically check the status of the PVC belt, and replace it, if necessary. Once the machine has been cleaned, the operator must check for worn out or damaged parts (in which case, he must replace it immediately), or for parts which are not firmly fixed (in which case, he should fix them, if this is possible).



The machine protection and safety devices must not be removed, unless a specific repair and/or maintenance action is required. These protections must be put back as soon as the reason for their removal has disappeared, in any case, they must be installed before starting the machine.




If using compressed air, the operator must wear safety glasses, and make sure that nobody is near the machine, because they may be hit by materials and dust.



6.2.3 Lubricate the Bearing

An oil injection nozzle is attached with the bearing pedestal, and there is no need to add lubricant grease to it. Remove dusts and pollutants in time for heat dissipation as showing in the picture below:

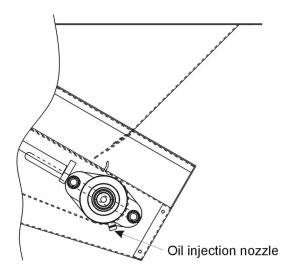

Picture 6-2: Bearing Pedestal

Stop the machine and unplug the power supply before doing the repair or maintenance work.



6.3 Maintenance Schedule 6.3.1 About the Machine Model ______ SN ______ Manufacture date _______ Voltage _____ Φ ____ V Frequency _____ Hz Power _____ kW 6.3.2 Check After Installation Check if the body of the machine installated horizontal Check for eventual leaks of lubricant from the reduction gear Check the status about the PU belt Electrical installation Voltage _____ V ____ Hz Check if the power connection of the control box is correctly 6.3.3 Daily Checking

- \Box Check the switches of the machine.
- Check if the reduction gears is oil leaking leaking.
- \Box Check the function of the safety switch.

6.3.4 Weekly Checking

Check all the electrical wires.

Check the protection function of the breaker.